

AVS SERVICE INSTRUCTIONS

STEP TYPE	KM	Last Updated	9/7/06
VEHICLE TYPE		Revision no:	1

FAULT: Step appears to move excessively inside case up and down and may spring out in certain circumstances.


CAUSE: Anti rattle springs have been damaged when step has been stowed whilst lifting the step tread and/or adjustment of latch arm required as part of 6 months service routine.

ACTION: Check anti-rattle springs on each side at front of case and replace if bent or not catching on side arm.



Adjust latch arm by releasing front nut by ½ turn and tightening rear nut by ½ turn therefore increasing purchase of latch arm on latch plate when stowed.



Side Arm Anti-rattle Spring Retaining bolt

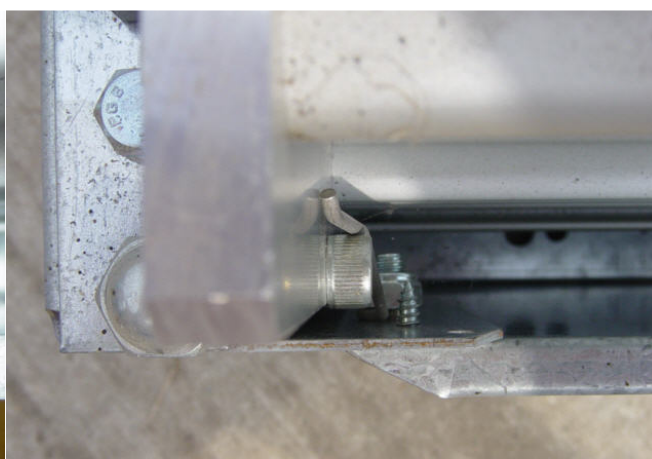

View showing correct alignment of Anti rattle spring.

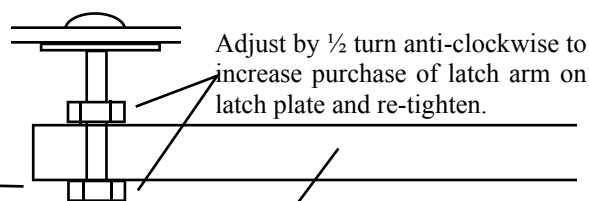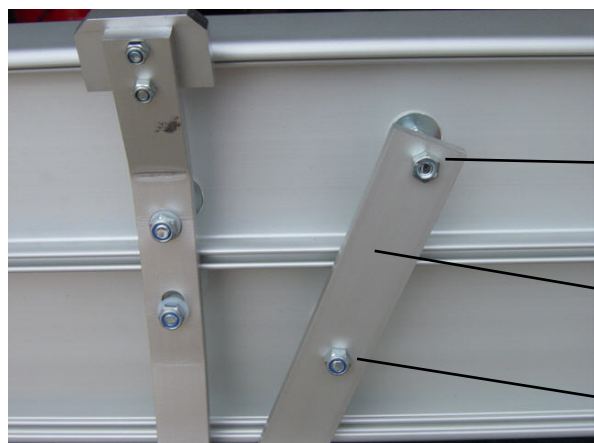

LATCH ARM

Adjust by ½ turn clockwise to increase purchase of latch arm on latch plate.